RTX-55-GMC

Dakota Digital RTX Instrument Installation
For 1955-‘59 GMC Pickups

Your new RTX-55-GMC kit includes:

RTX Display



Universal Sender Pack



Buzzer



Installation Manuals




Switch Assembly



36” Main Harness

Control Box

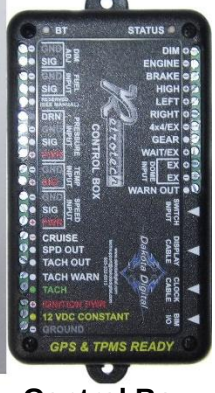

4X #8-32 x ½” Screws




4X #8-32 x 1 ½” Screws



2X Turn Signal Harnesses



2X Interconnect Harnesses

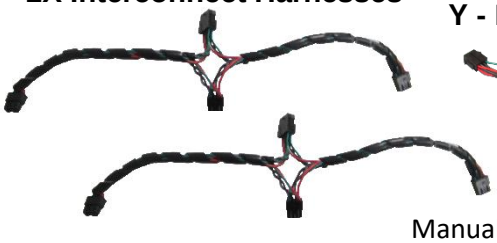

Y - Harness




Installation

1. Remove the stock instrument cluster from the dash.




2. Remove the original gauges and fasteners from the factory dash panels. Do not remove the six screws with washers that retain the four outer gauges, as these will be reused when mounting the RTX displays.

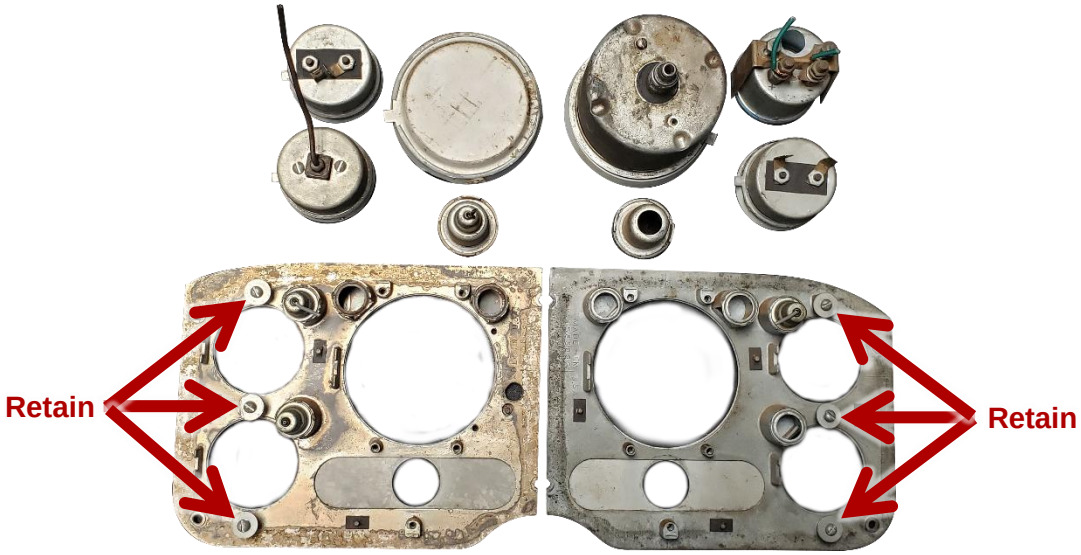


3. Insert the four smaller RTX displays into the outer openings from the back side. Fasten these displays down using the original screws with washers retained during the previous step.



4. Fasten the Speed and Tach RTX displays into place using the provided **#8-32 Screws**, with two 1 ½" long screws in the bottom mounting holes and two ½" long screws in the top mounting holes.

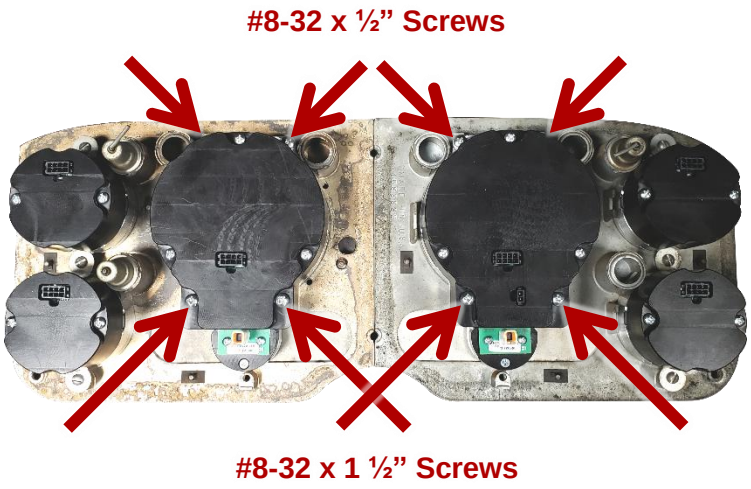


5. Connect the three displays on each panel using the two provided **Interconnect Harnesses**. Then, connect the two interconnect harnesses using the provided **Y-Harness**. Finally, connect the provided **36" Main Harness** to the open end of the Y-harness. Carefully route the open end of the main harness to the desired control box mounting location. The included **Buzzer** may also be installed for optional audio feedback.

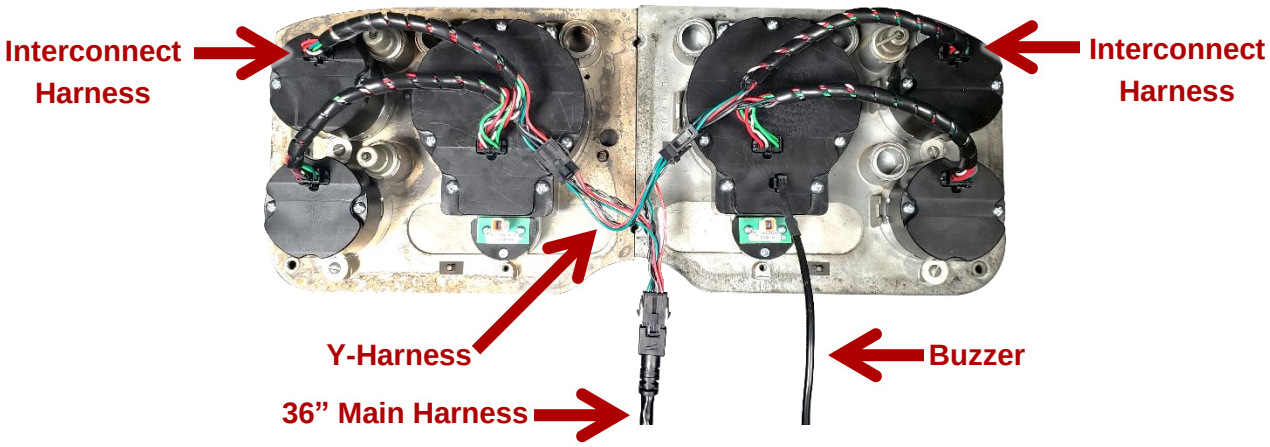

6. Connect the two provided two-wire **Turn Signal Harnesses**. Do not wire the turn signals to the RTX control box. Instead, connect to the original indicator circuit as follows:

WHITE\GREEN wire to **INDICATOR CIRCUIT**
WHITE\BLACK wire to **CHASSIS GROUND**

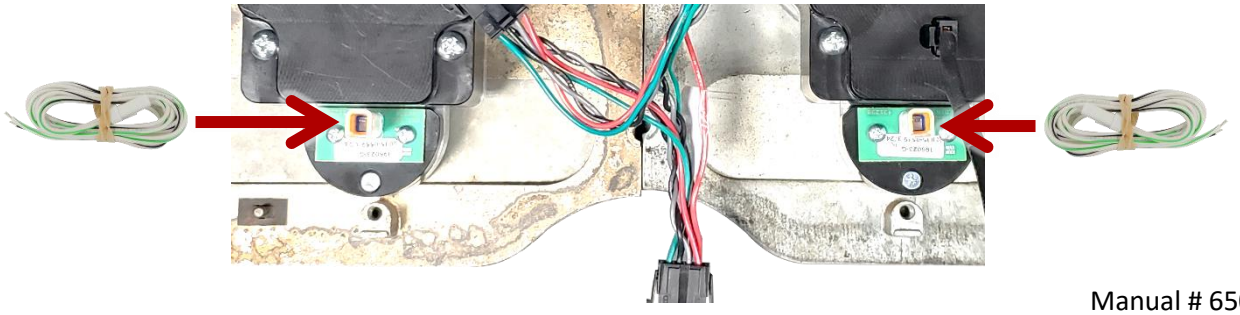

7. Re-install the assembled instrument panels into the dash. Refer to the main RTX manual for wiring instructions to complete the system installation.



⚠**WARNING:** This product can expose you to chemicals including lead, which is known to the State of California to cause cancer and birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov

4510 W. 61st St. North
Sioux Falls, SD 57107
www.dakotadigital.com
dakotasupport@dakotadigital.com

Phone (605) 332-6513
Fax (605) 339-4106

© Copyright 2024 - Dakota Digital